
KAD32P-A



KAD32P-A

REF	PART NO.	QTY	DESCRIPTION	SEE SEC.	NOTES
1	3580785	1	Circulation pump		Replaced by 1 pc 3809412, coolant pump, 1 pc 3588385, pulley and
					4 pcs 947760, flange screw.
	3809412	1	Circulation pump		Replaced by 1pc coolant pump 3809412, 1pc pulley 3588385 and
	2002060	1	Cira numn ayah		4pcs flsnge screw 947760.
2	3803869 184861	1	Circ. pump, exch Ball bearing		Exchange unit Included in overhaul kit.
3	3588402	1	Hub		included in overriaul kit.
4	3583087	1	Impeller, with shaft		Included in overhaul kit.
5	914462	1	Lock ring		Included in overhaul kit.
6	479977	1	• Plug		morado in overrida na
7	1660609	1	Ball bearing		Included in overhaul kit.
8	1676432	1	Sealing ring		Included in overhaul kit.
9	861541	1			EARLY TYPE. For multi-V-belt.
	3588385	1	Pulley		LATE TYPE. For multi-V-belt.
10	876793	1	Repair kit	3434	
11	859027	1	Gasket		Included in overhaul kit.
11A	947760	6			
12	3582167	1	Bracket		Included in service kit.
15	2502224	1	Tongion pulloy		Included in service kit.
15	3582324	1	Tension pulley		included in Service kit.
17	3582189	1	Spacer		Included in service kit.
17	3302103		Opacei		included in Service kit.
18	3582168	1	Gear		Included in service kit.
19	982331	1	Square neck screw		Included in service kit.
20	976945	1	Washer		(960148). Included in service kit.
21	971095	1	Nut		Included in service kit.
22	3582677	1	Nut		Included in service kit.
23A	861564	1	Drive belt		
24	3581470	1	Hose		Circulation pump-heat exchanger.
25	943478	1	Clamp		
26	3581460	1	Drive belt		
27	3581472	1	Pulley		
28	947760 977542	4	Flange screw V-belt		
29 30	877180	1	Service kit	3434	
30	677100	ı	Bulletin 44-48	44-48-EN	Belt tensioner Upgrade Kit for D32, 42WJ, 42, 44
			Dulletiii 44-40	44-40-LIN	Delt terisioner opgrade Kit for DSZ, 42W3, 42, 42, 44

7738870 - 26 - 3042B 21134 Upd: 08 JUN 2006

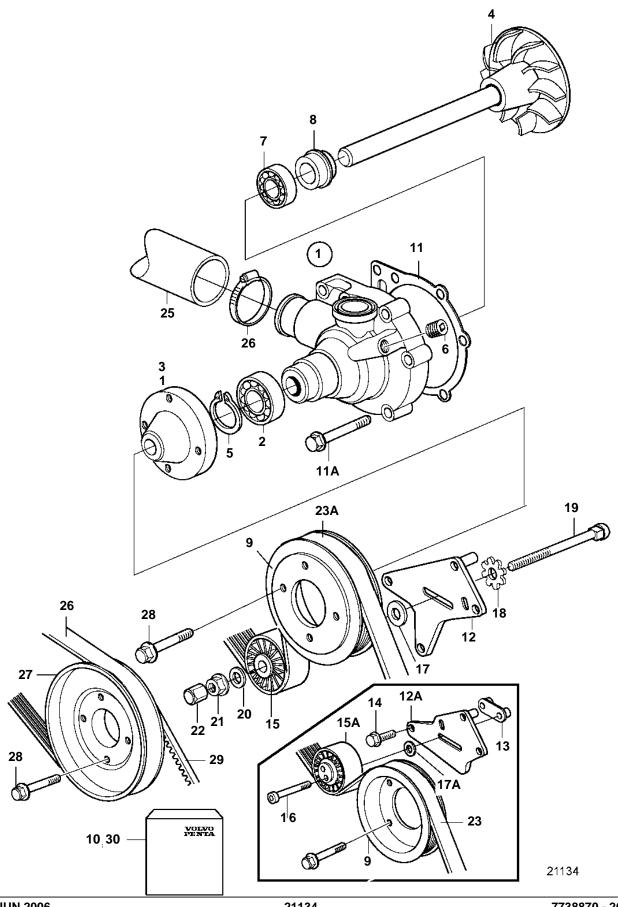